

# Manhole Inspection Summary

Manhole # S31AA1009MH

Printed On: 12/17/2008

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **31AA1** Node: **009** Status: **Found**

Insp Date: **8/25/08 10:23 AM**

Incomplete Comments

Crew: **REI2**  
Inspector: **Creary, B**  
Firm: **REI**

**Location** Address: **SAN MARTIN DR**

Cross Street: **JOHNS HOPKINS UNIV**

**Manhole** Type: **Inline** Location: **Grass** Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **There appears to be active infiltration in the Barrel of this MH.**

**Cover** Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **1** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment** ☐ Exists Material: ☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel** Material: **Precast Concrete** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Bench** ☒ Exists Material: **Brick** ☐ Parged ☒ **Debris** (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick** ☐ Parged ☐ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris


**Steps** Count: **5** Missing: **0** ☒ **Corroded**

**Surcharge** ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Location View



Top View

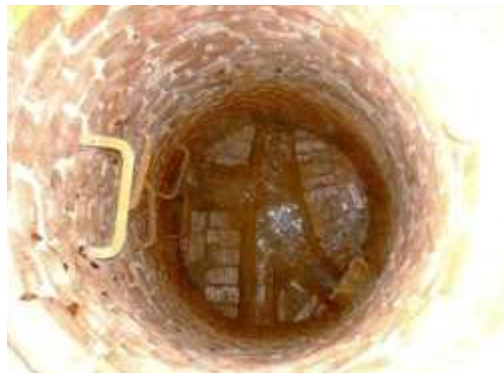

Corroded steps. Bench debris.

Defect



Corbel and Barrel infiltration.

Defect



Above grade.

Defect



Corbel infiltration.

Defect



Barrel infiltration (Active).

## Manhole Inspection Summary

Manhole # S31AA1009MH

Printed On: 12/17/2008

Page 3 of 4

### 8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **11.67** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☒ **Mud** ☒ **Sludge** ☐ Debris ☐ Grease

Silt Depth: **1** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

### 8 in. Circular Gravity Sewer Pipe In @ 4 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.25** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ **None** ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

### Drop In @ 4 O'Clock



Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **10.63** (ft.)

Inv Depth: **11.63** (ft.)

Drop Condition: **Partly Clogged**

Connects To: **Manhole**

☐ Possible Illicit Connection

## Manhole Inspection Summary

Manhole # S31AA1009MH

Printed On: 12/17/2008

Page 4 of 4

### Pipe In @ 6 O'Clock



Pipe Material: ☐ Pipe Lined  
Invert Depth: (ft.) Flow Characteristics:  
Deposits: ☐ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: (in.) Deposits Extent:  
Infiltration: Pipe Seal Cond:

Drop: **None**

Connects To: **Stub connection / abandoned**

☐ Possible Illicit Connection

### Pipe In @ 10 O'Clock



Pipe Material: ☐ Pipe Lined  
Invert Depth: (ft.) Flow Characteristics:  
Deposits: ☐ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: (in.) Deposits Extent:  
Infiltration: Pipe Seal Cond:

Drop: **None**

Connects To: **Stub connection / abandoned**

☐ Possible Illicit Connection